# wictotolic



# Instrucion manual Ics-Ultrasonic Sensors with one analogue output

lcs-25/IU/QP lcs-35/IU/OP lcs-130/IU/QP

- The lcs-sensor with one analogue output measures the distance to an object within the detection zone contactless. A signal proportional to distance is created according to the adjusted window margings of the analogue characteristic
- The sensor automatically detects the load put to the analogue output and switches to current output or voltage output respectively.
- Choosing between rising and falling output characteristic is possible.
- Light emitting diodes (three-colour LEDs) indicate the operation conditions.
- The sensors can be trained using Teachin processes.
- Using the LinkControl adapter (optional accessory) all sensor parameter settings may be made by a Windows-Software.

## Important instructions for assembly and application

All employee and plant safety-relevant measures must be taken prior to assembly, start-up, or maintenance work (see operation manual for the entire plant and the operator instruction of the plant).

The sensors are not considered as safety equipment and may not be used to ensure human or machine safety!

The Ics-sensors indicate a blind zone, in which the distance cannot be measured. The operating range indicates the distance of the sensor that can be applied with normal reflectors with sufficient function reserve. When using good reflectors, such as a calm water surface, the sensor can also be used up to its maximum range. Objects that strongly absorb (e.g. plastic foam) or diffusely reflect sound (e.g. pebble stones) can also reduce the defined operating range.

### Assembly instructions

- Assemble the sensor at the installation
- Plug in the connector cable to the M12 connector.

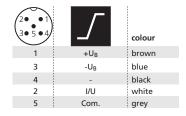


Fig. 1: Pin assignment with view onto sensor plug and colour coding of the microsonic connection cable

#### Assembly distances

The assembly distances shown in Fig.2 for two or more sensors should not be fallen below in order to avoid mutual interference

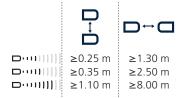


Fig. 2: Assembly distances

#### Start-up

Ics-sensors are delivered factory made with


- Rising analogue characteristic
- Window margins for the analogue output set to blind zone and operating

Set the parameters of the sensor using the

the following settings:

- Measurement range set to maximum

Teach-in procedure.

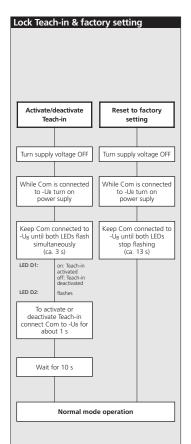

### Note

must be removed.

Ics-sensors have internal temperature compensation. Because the sensors heat up on their own, the temperature compensation reaches its optimum working point after approx. 30 minutes of operation.

Ics-sensors work maintenance free. Small

amounts of dirt on the surface do not influ-

ence function. Thick layers of dirt and caked-


on dirt affect sensor function and therefore


- If an object is within the set window margins of the analogue output, then LED D1 lights up green, if the object is outside the window margins, then LED D1 lights up red.
- The load put to the analogue output is detected automatically when turning supply voltage on.
- If the signal at the Com line does not change for 20 seconds during parameter setting mode the made changes are stored and the sensor returns to normal mode operation.
- You can reset the factory settings at any time, see »Lock Teach-in & factory setting«
- Ics-sensors optional can be programmed using the LinkControl adapter LCA-2, see «Optional setting of parameters using the LinkControl Adapter LCA-2».

CE

2014/30/EU



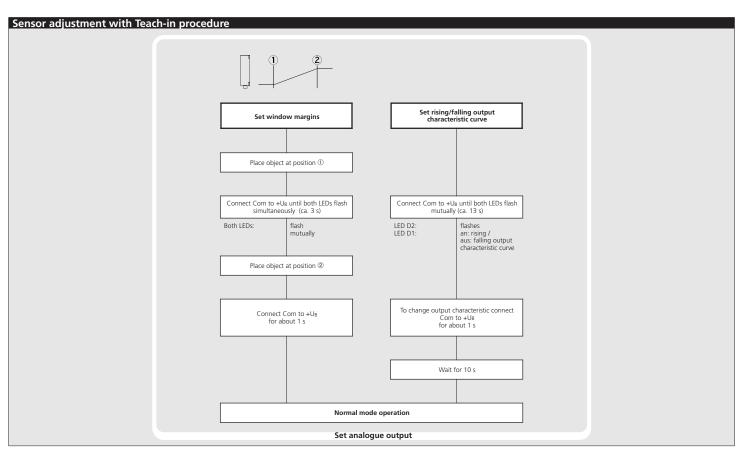

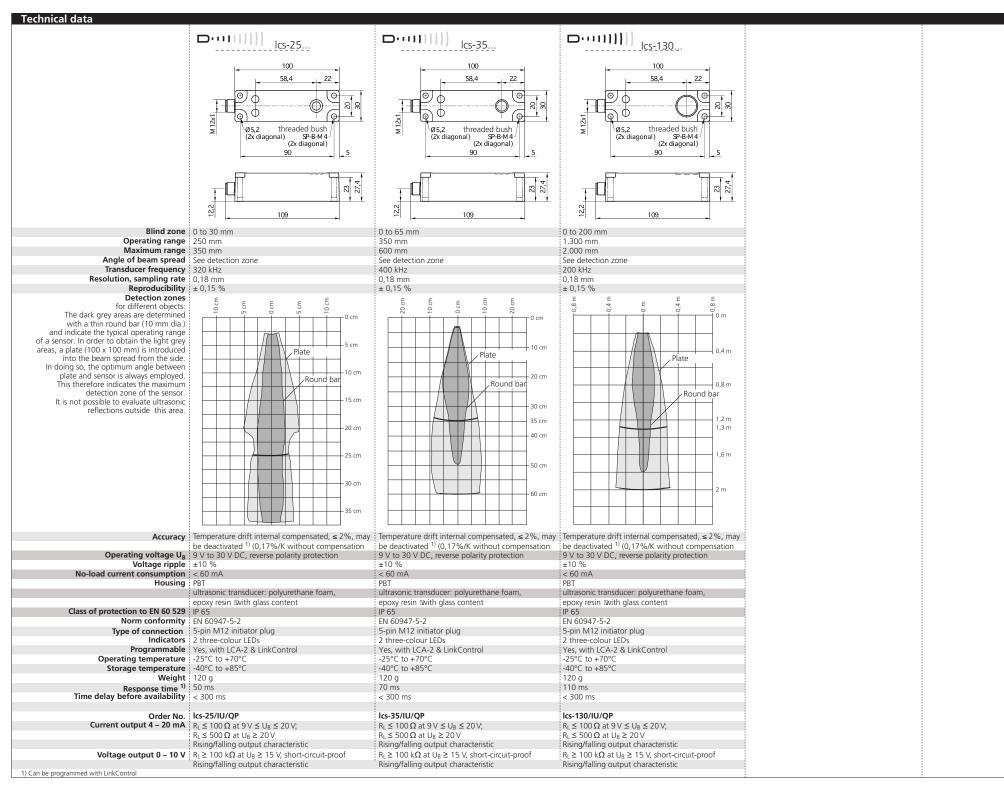

# Offline programming

- Load Sensor parameters in the LinkControl Adapter LCA-2
- Change parameters and additional functions as described here
- Write changed parameters back into the lcs- sensor

Please refer to the quick reference guide on the LCA-2.

